


HERITAGE-WTI, Inc.

1250 St. George Street
East Liverpool, Ohio 43920-3400
Phone: 330-385-7337
Fax: 330-385-7813
Web Site: www.heritage-wti.com

ISO 9001

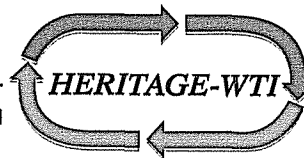

ISO 14001

April 20, 2010
VIA UPS

Mr. George Czerniak, Chief
U.S. EPA Region V
Air Enforcement and Compliance Assurance
Branch
Mail Code AE-17J
77 West Jackson
Chicago, IL 60604

Ms. Pamela Korenewych
OEPA-DAPC-NEDO
Environmental Specialist
2110 E. Aurora Road
Twinsburg, OH 44087

RE: HERITAGE-WTI, INC.
EXCESSIVE EXCEEDANCE REPORTING

Dear Mr. Czerniak:

Please find enclosed a written report entitled MACT Excessive Exceedance Report for Heritage-WTI, Inc. This report is required by 40 CFR 63.1206 (c)(3)(vi) whenever there is more than ten emission standard or operating parameter exceedances that occur within a sixty-day period.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are certain penalties for submitting false information including the possibility of fine and imprisonment for knowing violations.

Thank you and if you have any questions or comments, please call me at the above number.

Sincerely,

Frank Murray
General Manager
Heritage-WTI, Inc.

cc: Ed Fasco, Ohio EPA-DAPC-NEDO



Recycled Paper

bcc: Env. Dept
Frank Murray
Bob Buchheit
Kevin Lloyd

file name: environ/MACT/HWC MACT/exceedances/eer10_0420

MACT EXCESSIVE EXCEEDANCE REPORT

Heritage-WTI, Inc

April 20, 2010

Events

#	Name	Start Time	End Time	Cause (report)	Cause Description	Corrective Actions	(hr)	(min)	(sec)
1	THC	2/24/2010 3:35:22 PM	2/24/2010 4:37:21 PM	Operator Error - Feed Prep	Improperly prepared container feed caused THC spike.	Revise feed instructions. Restart unit.	1	1	59
2	THC	3/4/2010 7:27:22 PM	3/4/2010 8:23:23 PM	Operator Error - Poor Maintenance	Lance slagging due to poor maintenance caused poor combustion	Restarted unit. Cleaned lances.	0	56	1
3	SCC Pressure Using Seals	3/4/2010 9:56:32 PM	3/4/2010 9:56:37 PM	Operator Error - Poor Maintenance	Fan shutdown due to lance overfire	Maintained draft using ID fan damper	0	0	5
4	SCC Temperature	3/26/2010 2:13:32 AM	3/26/2010 2:20:31 AM	Operator Error- Poor Operation	Operator failed to correct for temperature loss.	Regained temperature and restarted unit.	0	6	59
5	THC	3/26/2010 3:44:29 AM	3/26/2010 4:19:29 AM	Operator Error- Poor Operation	Operator did not adjust unit properly to prevent THC	Increased ari flow. Restarted unit.	0	35	0
6	THC	3/27/2010 9:12:28 PM	3/27/2010 9:34:28 PM	Operator Error- Feed Prep	Improperly prepared waste feed caused THC event.	Re-trained technician. Restarted unit.	0	22	0
7	THC	4/6/2010 5:44:28 AM	4/6/2010 6:50:29 AM	Operator Error - Feed Error	Improper drum feed caused THC event.	Removed waste stream from waste feed mix.	1	6	1
9	THC	4/16/2010 8:20:25 PM	4/16/2010 9:20:22 PM	Operator Error - Feed Error	Skip hoist feed error caused THC event	Reduced feed size. Restarted unit.	0	59	57
10	THC	4/19/2010 4:30:22 AM	4/19/2010 5:29:22 AM	Operator Error - Feed Error	Drum feed error caused THC event	Removed waste stream from feed mix. Restarted unit.	0	59	0

** End of report **